

FORD:

2011-2013 F-150
2012-2013 Expedition
2011-2014 Mustang

LINCOLN:

2012-2013 Navigator

This article supersedes TSB **13-06-08** to update the Parts List.

ISSUE

Some 2011-2014 Mustang, 2011-2013 F-150, 2012-2013 Expedition and Navigator vehicles equipped with a 6R80 transmission and built on or before 4/8/2013 may exhibit a transmission engagement in 5th gear when starting. The wrench indicator and/or the seat belt minder may be illuminated, the speedometer reads zero and the odometer displays dashes while driving. Symptoms may clear after an ignition key cycle. Diagnostics trouble codes (DTCs) P0720 and P0722 may or may not be stored in the powertrain control module (PCM) memory.

ACTION

Follow the Service Procedure steps to correct the condition.

SERVICE PROCEDURE

Replace the molded leadframe on the main control assembly. Refer to Workshop Manual (WSM), Section 307-01 Shift Solenoids.

NOTE:

REPLACEMENT OF SHIFT SOLENOIDS ARE NOT REQUIRED FOR THIS PROCEDURE.

PART NUMBER	PART NAME
AL3Z-7G276-B	Molded Leadframe
XT-5-QLVC	Motorcraft® MERCON® LV Automatic Transmission Fluid

OPERATION	DESCRIPTION	TIME
160008A	2011-2013 F-150, 2012-2013 Expedition And Navigator 6R80 Transmission: Check DTCs And Replace The Molded Leadframe (Do Not Use With Any Other Labor Operations)	2.1 Hrs.
160008A	2011-2014 Mustang 6R80 Transmission: Check DTCs And Replace The Molded Leadframe (Do Not Use With Any Other Labor Operations)	2.2 Hrs.

WARRANTY STATUS:

Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage
Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

DEALER CODING

BASIC PART NO.	CONDITION CODE
7G276	D4

NOTE: The information contained in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.